

Navajo Abandoned Uranium Mine

Site Screen Report

This form is for use at the site of abandoned uranium mines (AUM) located on Navajo Nation lands. Applicable sites include all mine and mine features that have or have not undergone reclamation by the Navajo Abandoned Mine Lands Reclamation Program, including features, adits, pits and waste piles. Applicable sites also include all AUM sites listed in the USEPA CERCLIS database, all sites listed in the 2008 AUM GIS Report issued by USACOE and USEPA, all AUM sites on allotment lands associated with the Navajo Nation, and any and all AUM sites not listed in any database located on Navajo lands. Reconnaissance of any sites located on lands adjacent to Navajo lands that may be impacting Navajo lands will need to be coordinated with the authorities appropriate to those lands.

The purpose of the form is to ascertain the status and location of the identified AUM site, and record all immediate site information associated with the mine site. Decisions and recommendations on what additional steps are needed will be provided on a separate document.

Hoskie Henry AUM Site

Navajo AUM Northern Region

Prepared by:

Weston Solutions, Inc.

Contract: W91238-06-F-0083

12767.063.496.1111

August 2010

Part I Site Identification, Location and Status**Site Names and ID numbers as applicable****Mine ID:** 635, 636**Map ID:** #635 - N29
#636 - N26**CERCLIS:** NNN000909133**Navajo Abandoned Mine Land Reclamation Program:** NA-0902, NA-0901**Local name / Aliases:** None**Chapter and local area:** Teec Nos Pos Chapter**County:** Apache **State:** Arizona**Lat/Long:** #635 - 36.900361296 N / -109.267712698 W
#636 - 36.900615922 N / -109.272442006 W**Nearby road and highway:** Highway 160 **Local Post Office:** Teec Nos Pos**Surface Land Status: check one or more and provide ownership and contact information below****Tribal Trust Land** ☒
Private ☐
Bureau of Land Mgmt ☐
State ☐**Public lands** ☐
Tribal Fee Land ☐
Allotment ☐
Fee land ☐**Subsurface Mineral Rights:**

No information on subsurface mineral rights ownership was found in the EPA/AUM Database.

Claim and operator information:

The mine site surface land status is classified as Tribal Trust Land. Historical documents showed the operator of the mine as Vanadium Corp. of America from 1964 to 1966. No other historical ownership / lease information was identified in the EPA/AUM database.

Number of residential structures within 200 feet of mine: None**Estimated volume of mine waste onsite:** #635 – 10 yd³
#636 – None

Part II Summary of radiological readings

Site: Hoskie Henry

Mine ID: 635

Highest gamma radiation measurement:

102,351 counts per minute (cpm)

Describe any other radiological measurements:

A total of 1,337 gamma radiation measurements were collected from the mine site, ranging from 7,245 cpm to 102,351 cpm. Measurements collected in the vicinity of the waste debris were found at levels up to approximately 100,000 cpm, and the drainage at levels up to approximately 30,000 cpm. The measurements are represented in Figures 1 and 2.


Background Locations

#1 9,749 cpm

Average background = 9,749 cpm

Distribution Chart and Statistics:

The following chart and statistics were generated by ESRI ArcGIS 9.3.1, and show the general distribution of the site gamma radiation measurements. The horizontal X axis represents the gamma radiation reading levels in cpm (lowest levels to the left). The vertical Y axis represents the frequency of each gamma radiation level.

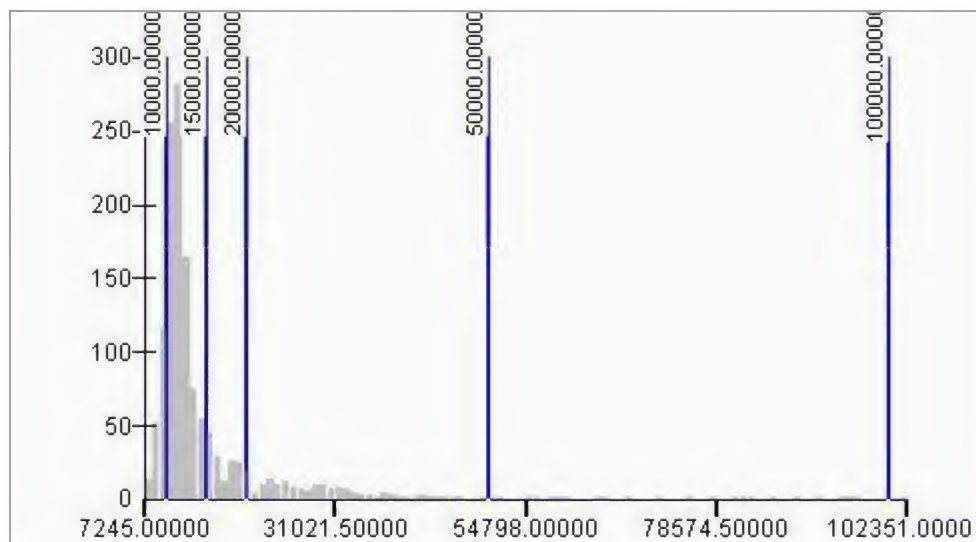

Count:	1337
Minimum:	7245.00000
Maximum:	102351.00000
Sum:	20583177.00000
Mean:	15395.04637
Median:	11807.00000
Standard Deviation:	11147.42135

Site: Hoskie Henry**Mine ID:** 636**Highest gamma radiation measurement:**

25,213 counts per minute (cpm)

Describe any other radiological measurements:


A total of 1,717 gamma radiation measurements were collected from the mine site, ranging from 7,377 cpm to 25,213 cpm. The measurements are represented in Figures 1 and 2.

Background Locations

#1 9,749 cpm

Average background = 9,749 cpm**Distribution Chart and Statistics:**

The following chart and statistics were generated by ESRI ArcGIS 9.3.1, and show the general distribution of the site gamma radiation measurements. The horizontal X axis represents the gamma radiation reading levels in cpm (lowest levels to the left). The vertical Y axis represents the frequency of each gamma radiation level.

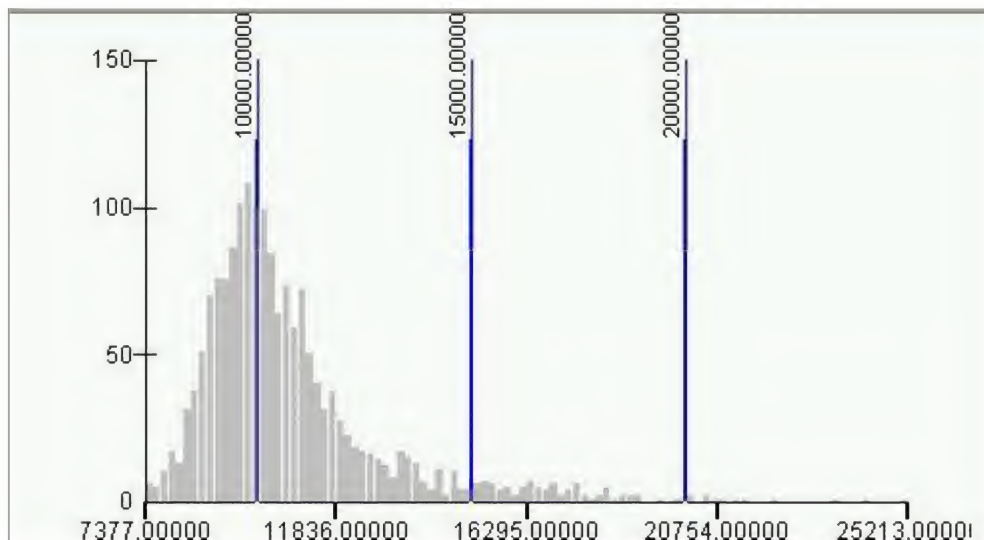

Count:	1717
Minimum:	7377.00000
Maximum:	25213.00000
Sum:	18456890.00000
Mean:	10749.49913
Median:	10193.00000
Standard Deviation:	2195.20164

Part III Status of Reclamation and Mine Waste

The following information was obtained from the Navajo Abandoned Mine Land Reclamation Program (NAMLRP) Point Features Database:

NAMLRP Status of the mine site: Reclaimed : Yes

Waste Pile onsite : No

NAMLRP Project Number: NA-0902, NA-0901

NAMLRP Mine features: 1 Portal, 1 Drill Hole

The following information was obtained from field observations collected during the 2010 site screening:

Provide description and status of all mine sites and features at site. Include all waste piles, adits, pits and other features, and indicate whether they are open, closed, covered, capped, buried or unreclaimed. Indicate approximate size, shape and extent, including description of any reclamation caps. Note condition of all caps.

Observed reclamation work and status:

Adits

None

Waste Piles

#635 – 8'x20'x1.5' waste rock pile

Pits

None

Shafts

None

Other Debris and Mine Features

Various mining evidence, timber, drill bits, etc., throughout site

Part IV

Site observations and Environs

Observed Structures: list number of and describe human habitation status of structures at the following distances from mine:

0 to 200 feet: None

200 feet to 0.25 mile: Clark housing compound (3 houses, many other structures) approx. 0.1 mi N of site #636, and 0.2 miles NW of site #635; John housing compound (3 houses, 3 structures, horses) approx. 0.1 E of site #635

Observed Public or commercial structure: list and describe all schools, clinics, Chapter Houses, places of business and any other structure used by members of the community at the following distances:

0 to 200 feet: None

200 feet to 0.25 mile: None

Levels measured around the perimeter(s) of the identified structure(s):

Consistent with background levels

Observed water sources: list the number and type of wells and surface water sources that are potentially used for human consumption at the following distances from the mine:

0 to 0.25 miles: Well at Clark house, 0.1 mi N of site #636 and 0.2 mi NW of site #635

0.25 miles to 4 miles: None

Sensitive environments: note and describe all sensitive environments located within visible range of the mine site, including: wetlands, endangered species, habitats and approximate locations of sites that may be under protection of the government of the Navajo Nation.

None

Known Site History: include information from interviews with Chapter officials and residents. Note information on mine ownership, type of mining operation, period of operation, known amount of production, and any other information as provided.

Henry Hoskie mine consists of 2 sites, #635, with an area of 21,709.92 m² and #636 with an area of 24,409.69 m². The mine was identified as being operational from 1964 to 1966. Historical documents showed the operator of the mine as Vanadium Corp. of America from 1964 to 1966. While operational, the mine had a total reported production volume of 978 tons. No other historical information or any additional ownership / lease information was identified in the EPA/AUM database.

Part V Response Action Summary

Site Name(s): Henry Hoskie **Chapter:** Teec Nos Pos

Decision Criteria

Is there an unreclaimed waste pile at the site? Yes

At what distance from the waste pile is the nearest residential structure located? 0.25 mi

At what distances from the waste pile are there potential drinking water sources? 0.25 mi

Is there a reclamation cap or sealed adit in place at the site? No

Is the cap/seal functionally intact? None

Is the cap/seal sufficiently degraded to create a concern about releases? None

At what distance from the cap/seal is the nearest domestic structure located? None

At what distance from the cap/seal is the nearest domestic drinking water source? None

Summary of emergency response factors

None

Summary hazard ranking system factors

None

Summary of reclamation factors

Unreclaimed waste rock

Part VI Photos



Photo 1. Henry Hoskie site #635



Photo 2. Henry Hoskie site #635, waste pile



Photo 3. Henry Hoskie site #635, mining debris



Photo 4. Henry Hoskie site #636



Photo 5. John housing compound



Photo 6. Clark housing compound



Photo 7. Clark housing compound well

Part VII Contacts Reports and Information

Name: Stanley Edison (928) 871-6861

Eugene Esplain (928) 871-7331

Title or official role (if any) Navajo EPA Superfund Program

Address___PO Box 2946, Window Rock, AZ 86515

Information provided Lead Regulatory Agency

Name: Margaret and George John 505.406.5987 or 505.716.6228

Title or official role (if any) Local residents

Information provided General background information for the area

Name: Henry Tso

Title or official role (if any) Local resident

Information provided General background information for the area


Name: Harry Clark 928.205.1331

Title or official role (if any) Local Resident

Address___PO Box 1071 Teec Nos Pos AZ, 86514

Information provided Son of Betty Clark, a nearby resident who had a hogan removed in 2000 due to high levels of radiation,

**Figure 1 - Gamma Radiation Measurements, Above Two Times Background
Henry Hoskie (635, 636)
Teec Nos Pos Chapter, Navajo Nation**

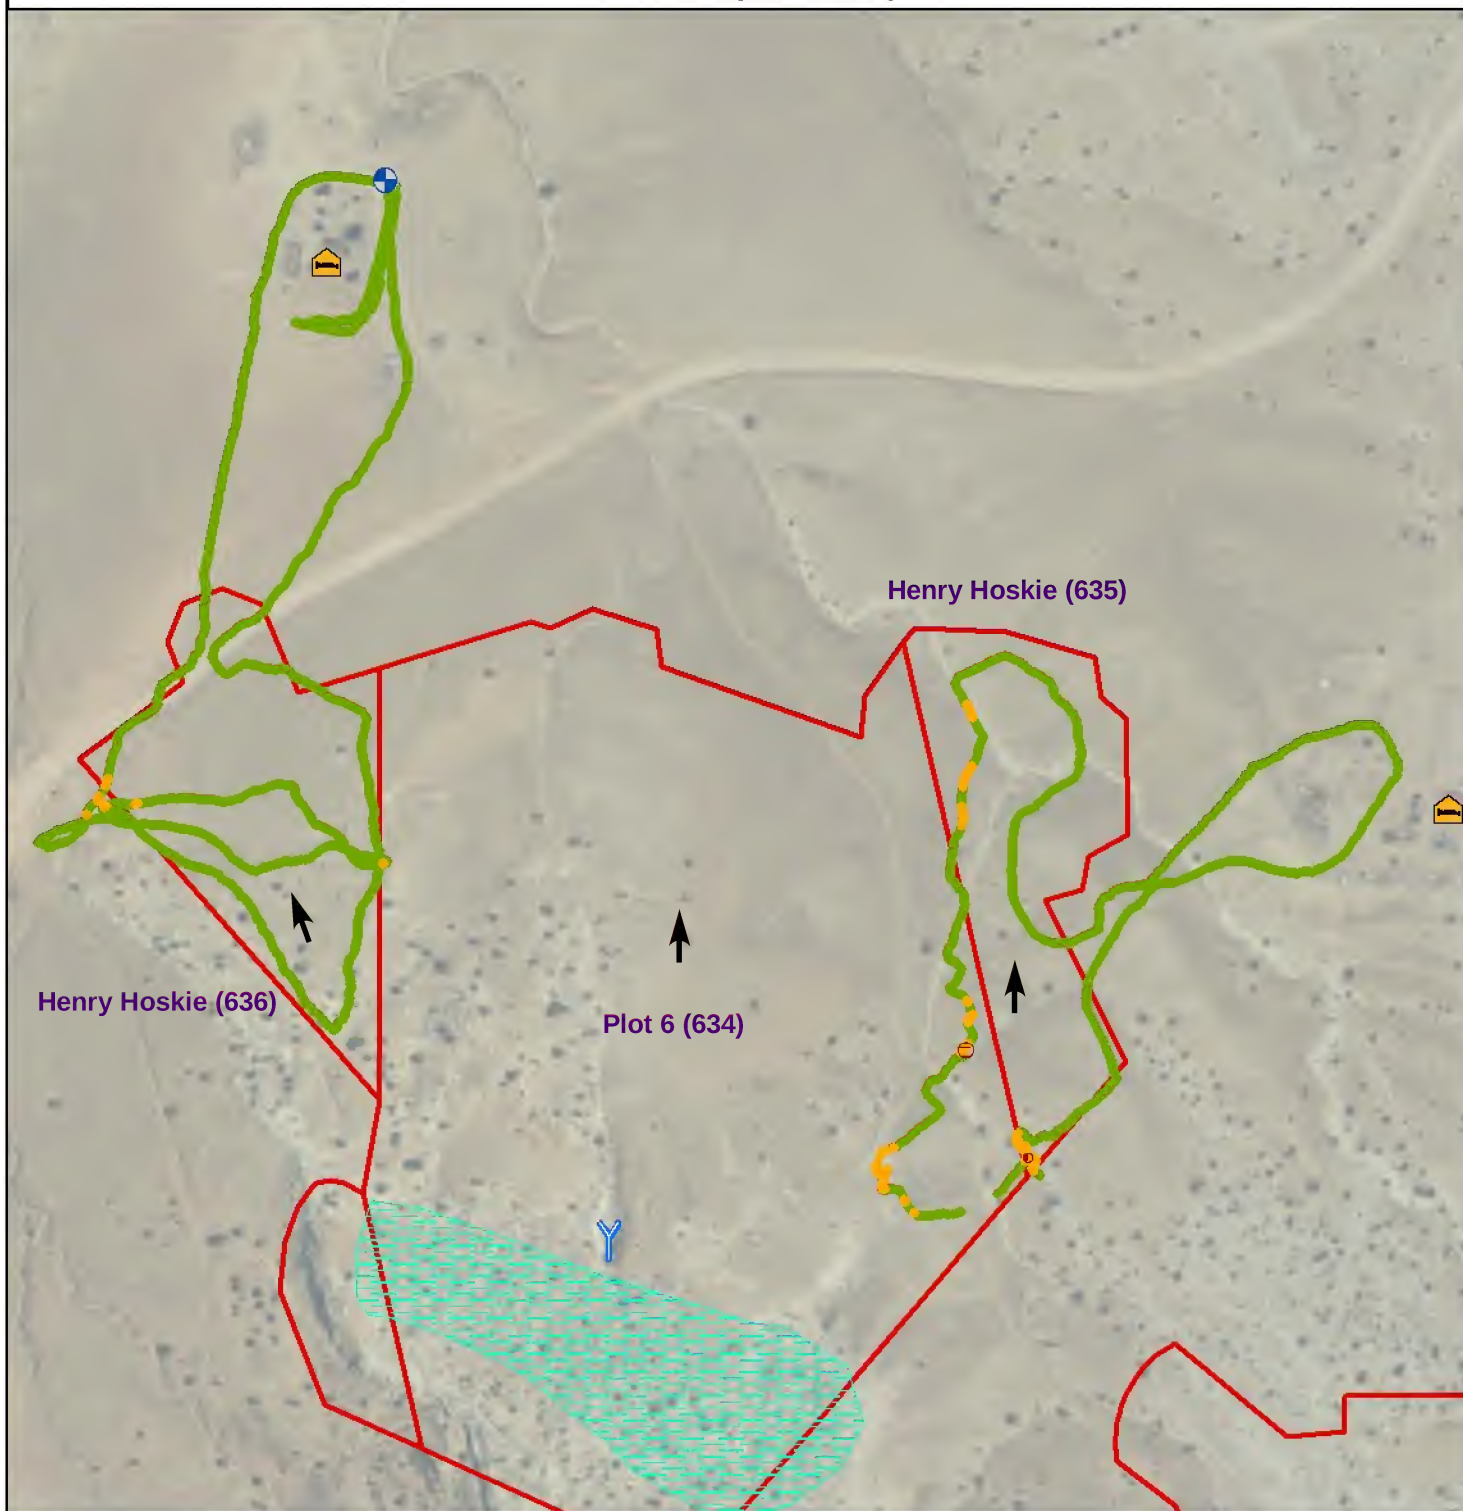

Legend

Gamma Radiation Measurements

- < 2X Background
- > 2X Background

Gamma survey conducted 06/2010
Measured as counts per minute (cpm)

Average background = 9,749 cpm

➔ General Direction Down-Slope

▭ Mine Claim Boundaries

Y Observed Adit

▨ Observed Reclamation Cap

▨ Observed Waste Pile

🏠 Observed Housing Structure

⊕ Observed Well




0 500 Feet



WESTON
SOLUTIONS

Figure 2 - Gamma Radiation Measurements
Henry Hoskie (635, 636)
Teec Nos Pos Chapter, Navajo Nation

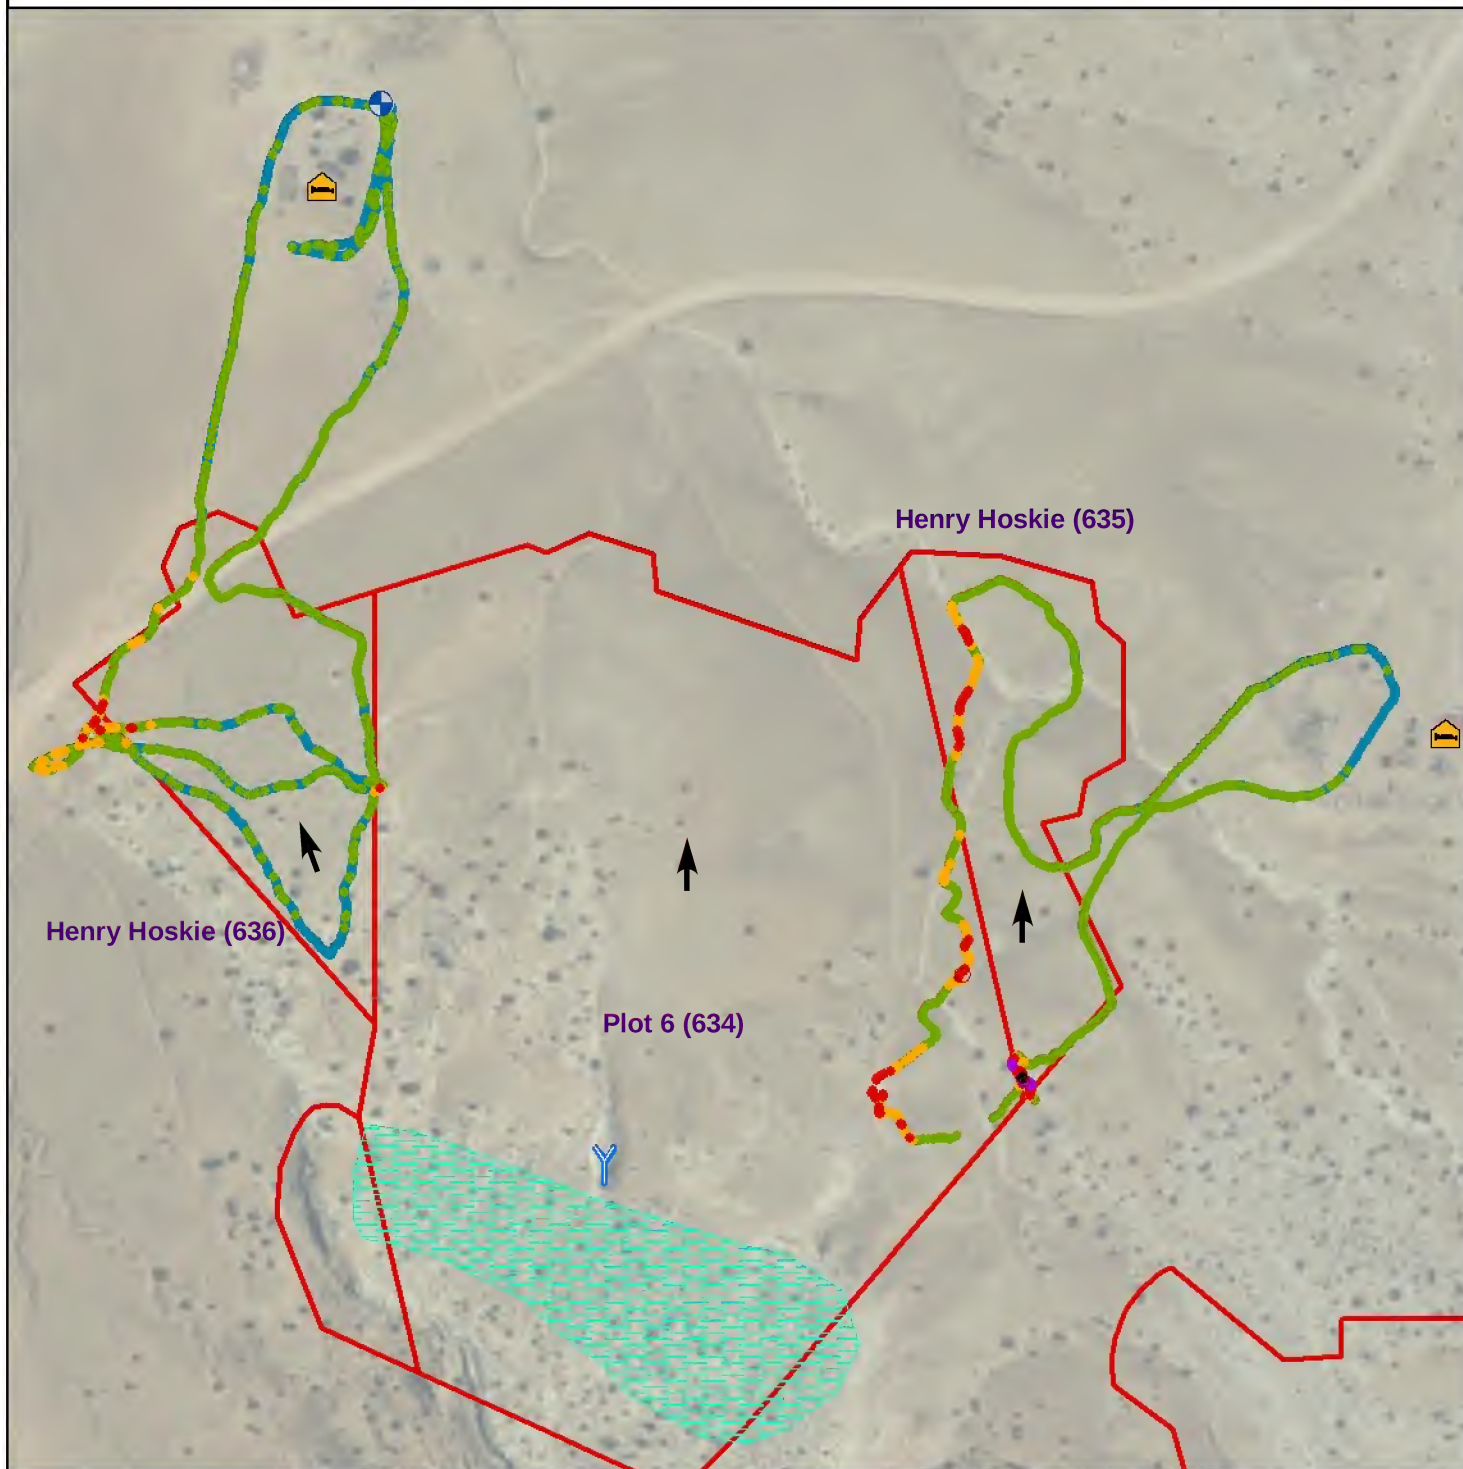

Legend

Gamma Radiation Measurements

- 0 - 10,000
- 10,000 - 15,000
- 15,000 - 20,000
- 20,000 - 50,000
- 50,000 - 100,000
- > 100,000

- ➔ General Direction Down-Slope
- ▭ Mine Claim Boundaries
- Observed Adit
- ▨ Observed Reclamation Cap
- ▨ Observed Waste Pile
- 🏠 Observed Housing Structure
- ⦿ Observed Well

Gamma survey conducted 06/2010
 Measured as counts per minute (cpm)
 Average background 9,749 cpm

